S E C R E T 270351Z

OUT 52370 1963 NOV 27 Ø4 11Z 27 NOV 1963

HFS K

Craco (File)

25X1

FROM NATIONAL PHOTOGRAPHIC INTERPRETATION CENTER. SECRET.


- CAMERA C-118, LENS D-5, WAS USED IN MISSION G 3235 FLOWN ON 26 OCTOBER 1863; PROCESSING WAS ACCOMPLISHED IN THE FIELD.
 - ORIGINAL NEGATIVE:
- THE EXPOSURE IS ADEQUATE AND THE RESOLUTION IS FAIR TO POOR. PORTIONS OF THE DEGRADED RESOLUTION IS DUE TO ATMOSPHERIC CONDITIONS; HOWEVER, WHERE THE TERRAIN IS CLOUD AND HAZE FREE THERE ARE LIMITED SMALL AREAS WITHIN THE FORMAT WHERE THE RESOL-UTION IS GOOD. THE RESOLUTION IS POOREST IN THE OUTBOARD CORNERS OF THE FORMAT AND IMPROVES PROGRESSIVELY TOWARDS THE CENTER, BUT IN NO INSTANCE IS THE RESOLUTION OPTIMUM.

9R SIDE: THERE ARE NUMEROUS PINHOLES AT THE BEGINNING OF THE MISSION AND IN FRAMES 637 THROUGH 650. FRAME 1331 CONTAINS A REPAIRED TEAR AND FRAME 2395 CONTAINS AN EDGE TEAR. PROCESSING STREAKS ARE NOTICEABLE THROUGHOUT THE MISSION. THE TITLING IS SMEARED FROM FRAME 1231 TO 1596 AND THERE ARE HEAVY EMULSION AND BASE SCRATCHES THROUGHOUT THIS SAME AREA, THE MOST PREDOMINANT BEING AN EMULSION SCRATCH IN THE FORMAT AREA ALONG THE TITLED EDGE. FINE LINE SCRATCHES ARE NUMEROUS AND APPEAR INTERMITTENTLY

Declassification Review by NGA/DoD

25X1



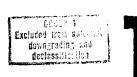

THROUGHOUT THE MISSION. A SHADOWGRAPH OF A PIECE OF LINT IS

PRESENT IN THE DATA CHAMBER AREA THROUGHOUT THE MISSION. SPLICES

ARE NOTED BETWEEN THE FOLLOWING FRAMES: 532-533; 1000-1001;

1064-1065; 1230-1231; 1596-1597; 1862-1863; 2128-2129; 23942395; 2660-2661; 2926-2927; 3193-3194 AND 2358-3459.

MANUFACTURERS' SPLICES OCCUR IN FRAMES 2194 AND 3318 AND A HEAT

SPLICE IS PRESENT IN FRAME 1249.

- C. 9L SIDE: RESOLUTION RANGES FROM POOR TO GOOD. AREA IN VICINITY OF OUTBOARD EDGE APPEARS OUT-OF-FOCUS, PARTICULARLY AT THE CORNERS. AREA OF RELATIVELY GOOD PHOTOGRAPHY ASSUMES A ROUGHLY HEMISPHERIC CONTOUR WITH THE FLAT OR BASE SIDE ON THE INBOARD EDGE AND PEAKING OUT NEAR THE OUTBOARD EDGE. BEST RESOLUTION APPEARS TO BE IN THE 1R FRAMES ALTHOUGH THESE ARE ALSO AFFECTED BY THE OUT-OF-FOCUS CONDITION. THERE ARE MINOR PROCESSING STREAKS AND INTERMITTENT PINHOLES THROUGHOUT THE MISSION. FRAMES 524 AND 1000 CONTAIN SEVERE SCRATCHES. FOREIGN MATERIAL IS NOTED IN FRAME 530 AND A FLARE IS NOTED IN FRAME 2186.

 MANUFACTURERS' SPLICES OCCUR IN FRAMES 527, 1743 AND 3436. HEAT SPLICES ARE PRESENT IN FRAMES 1244 AND 2411. AN EMULSION LIFT IS NOTED IN FRAME 3436.
 - D. BOTH SIDES: THE NEGATIVES ARE TITLED 20 OCTOBER 1963

AND THE DATA SHEETS INDICATE THAT THE MISSION WAS FLOWN 26 OCTOBER 1963. THERE ARE A TOTAL OF 2917 EXPOSURES IN THIS MISSION. THE FIRST FRAME IS NUMBERED 518 AND THE LAST FRAME IS 3584.

3. POSITIVE:

- A. THE PI SUTIABILITY IS GOOD EXCEPT WHERE DEGRADED BY OUT-OF-FOCUS AREAS DESCRIBED IN PARAGRAPH 2. ABOVE. THE PRINTING AND PROCESSING OF THE POSITIVES ARE GOOD.
- B. CLOUDS COVER APPROXIMATELY 60 PER CENT OF THE RETAINED PHOTOGRAPHY.

SECRET

-END OF MESSAGE-